

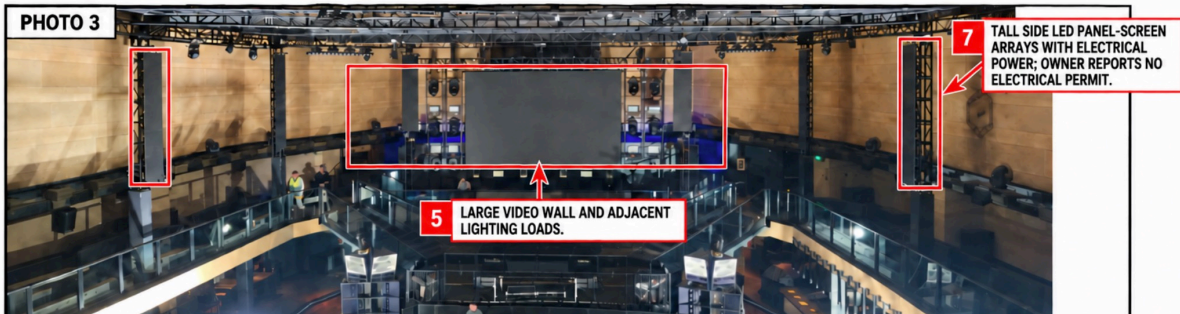
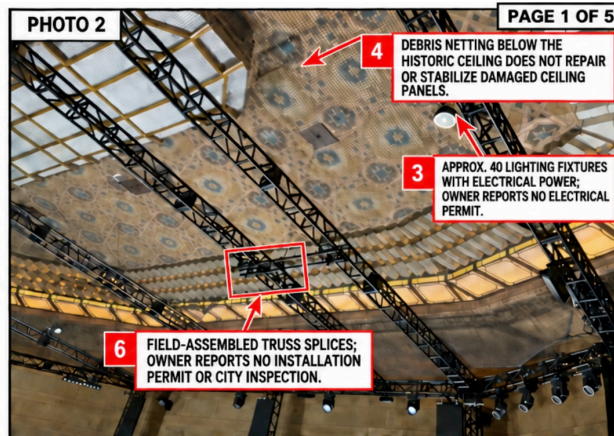
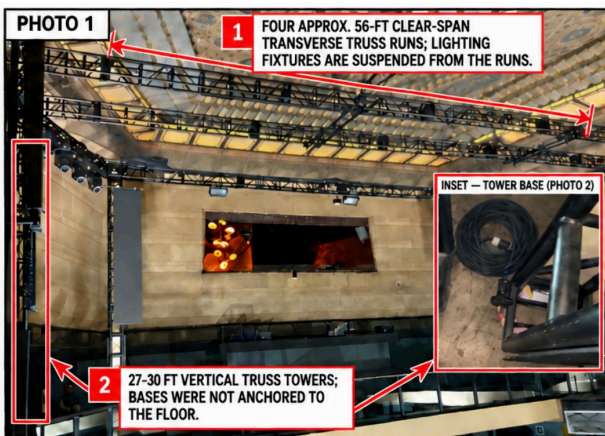
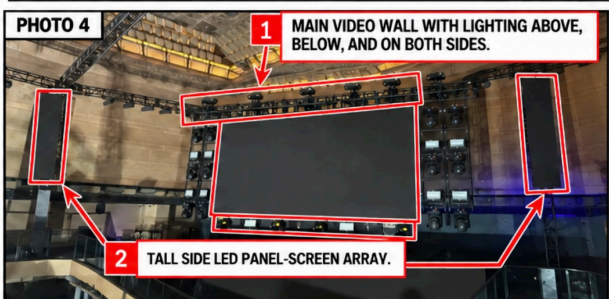
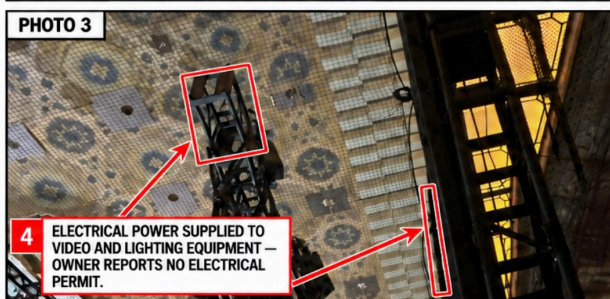


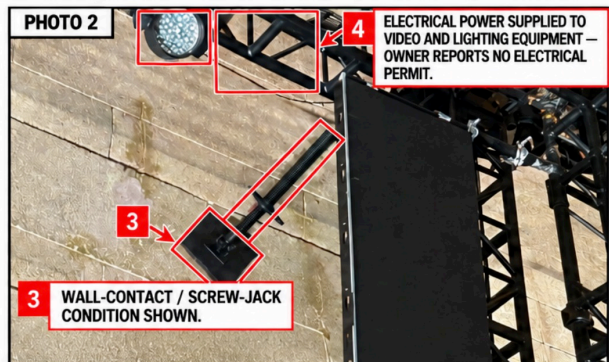

OWNER REPORTS THE 56-FT TRUSS SYSTEM, UNANCHORED BASES, LIGHTING, VIDEO DISPLAYS, AND ASSOCIATED ELECTRICAL WORK WERE INSTALLED WITHOUT PERMITS. COMPLAINTS HAVE BEEN SUBMITTED TO OSHA, LADBS, LAFD, THE LOS ANGELES CITY COUNCIL PUBLIC SAFETY COMMITTEE, AND OTHER AGENCIES; OWNER REPORTS NO SUBSTANTIVE FOLLOW-UP TO DATE.

PHOTO EVIDENCE — VIDEO WALLS, LIGHTING LOADS AND WALL-CONTACT BRACING

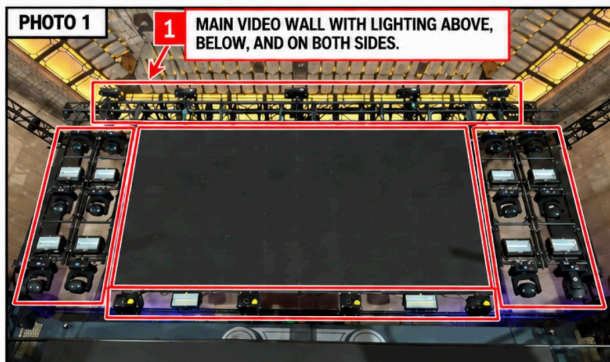

5 CURRENT VIDEO-WALL/TRUSS CONFIGURATION REPLACED THE EARLIER SUSPENDED CURVED-SQUARE TRUSS SYSTEM SHOWN IN PRIOR RECORDS.

PHOTO DOCUMENTATION OF LARGE DISPLAY AND LIGHTING LOADS WITHIN THE VERTICAL TRUSS SYSTEM. OWNER REPORTS NO BUILDING, INSTALLATION, PLAN-CHECK, OR ELECTRICAL PERMITS FOR THIS WORK.

PHOTO EVIDENCE — FULL TRUSS SYSTEM AND EAST/STAGE-SIDE CEILING CONCENTRATION — PAGE 3 OF 5

PHOTO 1 — FULL SYSTEM VIEW

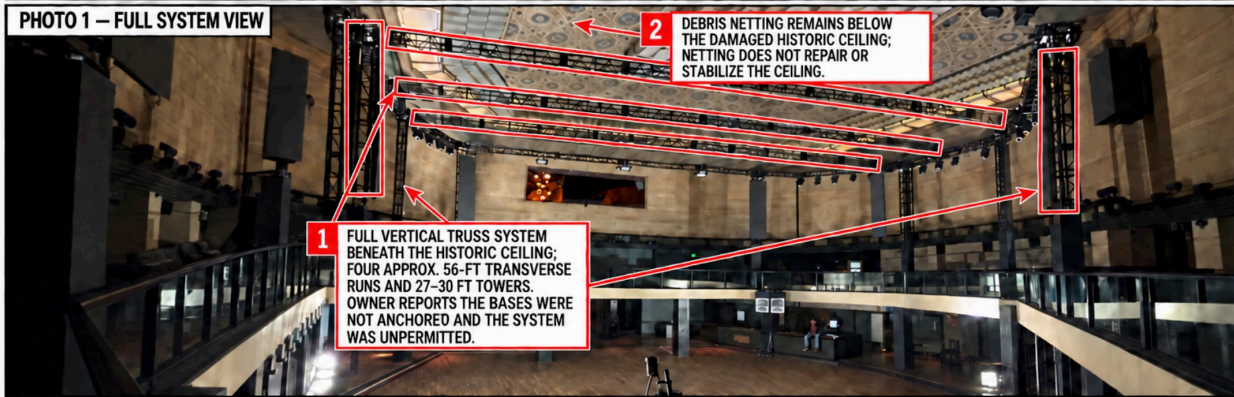


PHOTO 2 — CEILING CLOSE-UP


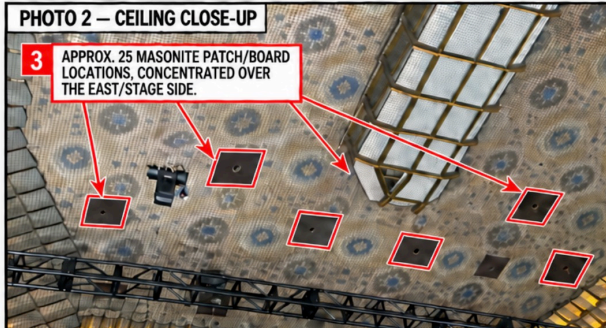


PHOTO 3 — HOPPER LOCATION MAP (DRAWING EXCERPT)

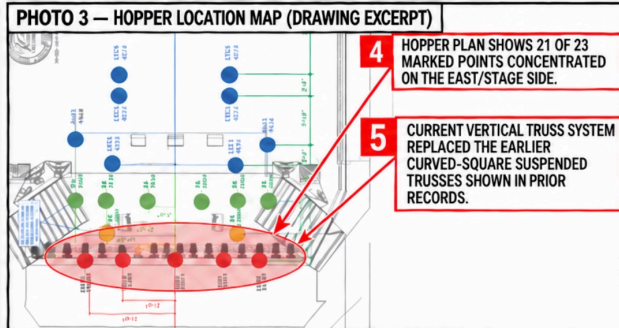

DOCUMENTED CONDITIONS SHOW A CONCENTRATION OF CEILING PENETRATIONS AND RIGGING ACTIVITY OVER THE EAST/STAGE SIDE. OWNER REPORTS THE WORK WAS PERFORMED WITHOUT PERMITS.

PHOTO EVIDENCE — PLENUM-SIDE CEILING PENETRATIONS AND DAMAGED LATH

PAGE 4 OF 5




1 PLENUM-SIDE VIEW OF RAGGED OPENING THROUGH HISTORIC PLASTER CEILING ASSEMBLY.



2 TORN OR BENT METAL LATH AND FRACTURED PLASTER AROUND RIGGING PENETRATION.



3 CHAIN/CABLE AND HARDWARE PASS THROUGH DAMAGED CEILING OPENING.

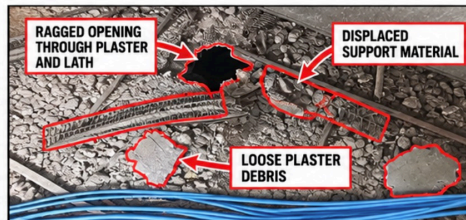

4 LOOSE PLASTER DEBRIS AND DISPLACED SUPPORT MATERIAL SURROUND THE OPENINGS.

REPORT FINDINGS

HBS (MAY 13, 2024):
APPROX. 20-40 HOLES, FROM ABOUT 4 INCHES TO MORE THAN 12 INCHES; PLASTER ON METAL-MESH LATH SUPPORTED BY THIN BLACK-IRON CHANNELS.

FICCADENTI (DEC. 18, 2024):
SOME PENETRATIONS DAMAGED CEILING-SUPPORT WIRES, INCREASING FALLING-TILE RISK.

THESE PHOTOS DOCUMENT THE UPPER/PLENUM SIDE OF THE 97-YEAR-OLD DECORATIVE CEILING.
OWNER REPORTS THE PENETRATIONS AND RIGGING WORK WERE UNPERMITTED.



MAKESHIFT LUMBER ACCESS OVER THE HISTORIC CEILING.



ELECTRICAL BOX / RECEPTACLE IN THE PLENUM; OWNER REPORTS NO ELECTRICAL, PERMIT. PHASE CANNOT BE DETERMINED FROM THIS PHOTO.



ELECTRICAL CABLING, RIGGING HARDWARE, AND CEILING DEBRIS IN THE SAME PLENUM AREA.



THREADED CONCRETE-BEAM THROUGH-BOLTS AND WIRE-ROPE RIGGING CONNECTIONS.



REPORT

EVERGREEN (APR. 22, 2024)

RECORDED 2x6 LUMBER USED AS A MAKESHIFT CATWALK, PRECARIOUSLY BALANCED ON THE BLACK-IRON MATRIX, PLACING HISTORIC TILE AT DIRECT RISK.

HBS (MAY 13, 2024)

RECORDED NEWER 2x LUMBER LAID ACROSS THE CEILING FOR WORKER ACCESS.

THE EXTERIOR APPEARANCE OF A RECEPTACLE DOES NOT IDENTIFY SINGLE-PHASE OR THREE-PHASE SERVICE; CONDUCTORS, VOLTAGE, BREAKER, RECEPTACLE CONFIGURATION, AND EQUIPMENT NAMEPLATE ARE REQUIRED.